

**Polycarbonate compound, halogen-free flame retardant,
 UL reference E346354-20111114
 (y) represents a four-digit color code**

Application: Technical injection molded parts


Typical values	Condition	Unit	Test method	Values
Mechanical properties				
Charpy unnotched impact strength	23 °C	kJ/m ²	ISO 179/1eU	No break
Charpy notched impact strength	23 °C	kJ/m ²	ISO 179/1eA	10
Tensile modulus	1 mm / min	MPa	ISO 527-1	2.200
Yield Stress	50 mm / min	MPa	ISO 527-1	60
Yield Strain	50 mm / min	%	ISO 527-1	6,2
Thermal properties				
Vicat Softening temperature	50°C / 50 N	°C	ISO 306	141
Heat deflection temperature HDT A	1,80 MPa	°C	ISO 75-2	124
Heat deflection temperature HDT B	0,45 MPa	°C	ISO 75-2	136
Properties				
Density	23 °C	g/cm ³	ISO 1183	1,2
Flammability	1,5 mm		UL 94	V0
Flammability	3,0 mm		UL 94	V0
Glow wire test GWFI	1,5 mm		IEC 60695-2-12	960°C

Processing recommendations:
Drying

Drying temperature in °C	Drying time (h) Dry air dryer
100-120	2-4

- Residual moisture content max 0,02 %
- When downtime of 4 hours, we recommend lowering the temperature of the dryer by 40 °C.

Processing recommendations

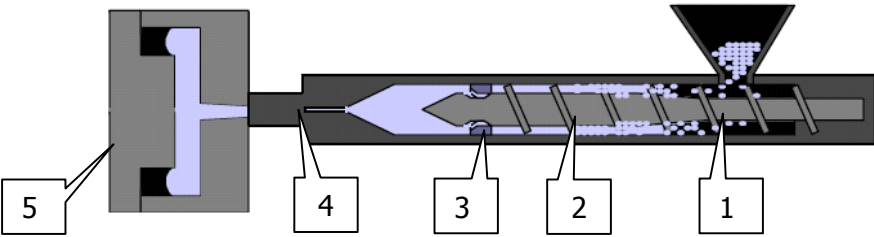

Melt temperature (°C)	5. Mold (°C)	4. Nozzle (°C)	3. Zone (°C)	2. Zone (°C)	1. Zone (°C)
280-310	80-120	280-310	280-310	270-300	250-270

- Shrinkage according to Literature: 0,4 to 1,0 % (depending on the part geometry and the process)
 - Setting may be different depending on the part design and machine type of recommended values.

Test Values

The stated values were – if not otherwise stated – taken on standardized test specimen at room ambient temperature. The specifications have to be regarded as guidance values, but not as binding minimum values. Please note that the properties can be considerably influenced by mould design, processing parameters and coloring.

Processing Instructions

When processing on the basis of the recommended processing parameters, small quantities of dissociation products can emit. According to the safety data sheet, the workplace exposure limit has to be kept by means of adequate exhaustion and ventilation, in order not to affect the machine operators' health and well-being. The compulsory processing temperatures must not be considerably exceeded, in order to avoid a stronger partial decomposition of the polymers and dissociation of volatile decomposition products.

Disclaimer

All information, documents and presentations published on this website are the exclusive property of geba. The permission of use is given with the reservation of the copyright being shown on all copies, the use being strictly personal and not exploited for business purposes, the information not being altered and all presentations of the website only being used together with the appendant texts. geba does not assume liability nor guarantee for any information, documents or presentations on the website. geba is not responsible for any damage of a nature which soever possibly resulting from a use or from the existence of this website along with the included information, documents and presentations. The user alone assumes full responsibility for all risks that might arise from his use of this website. With respect to the documents and information on the website, geba reserves all rights to make amendments at any time without prior announcement. The user is to the full extent responsible for all information he sends to geba with respect to its contents and correctness and the non-infringement of a third party's rights.